

Twister® Wire Connectors *Instructions*



WARNING - SHOCK HAZARD

Contact with electricity can cause electrical fires, serious injury or death. Shut off power to the circuit or remove fuse before using this product.

SAFETY NOTICE

Improperly installed electrical wiring can be dangerous and cause electrical fires. The connector chosen must be sized to the wires being used. Consult local building codes before doing any electrical wire and to determine installation requirements. For assistance, refer to an instructional book for electrical installations or consult a qualified electrician.

To be sold only with installation instructions.


Installation Instructions

- 1. Turn off power before removing or installing connectors.
- 2. Strip connectors to the correct strip length per the chart below:


Connector	Strip Length
340 TM	Strip wires #22-#18 AWG 3/8" (9,5mm)
	Strip wires #16-#10 AWG 7/16" (11mm)
341®	Strip wires 1/2" (13mm)
342®	Strip wires 5/8" (16mm)
344®	Strip wires 1/2" (13mm)
347	Strip wires 1/2" (13mm); 7/16" (11mm) for 4 #10 AWG stranded

- 3. Straighten and align frayed strands.
- 4. Hold wires together with ends even. Lead stranded wires slightly ahead of solid wires.
- 5. Pre-twisting acceptable, but not required. For pre-twisting; strip wires long, hold wires together with insulation even, twist wire ends together, trip to recommended strip length.
- 6. Insert bundle into connector and twist clockwise until tight.


For Models 340[™], 341[®], 342[®]



For Model 344®

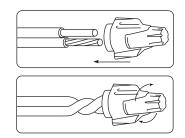

For Model 347

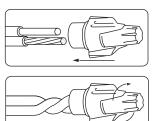

Use only on Copper to Copper (Cu/Cu) wire combinations.

For use in dry locations only.

Temperature rating: 105°C (221°F) maximum.

Models 340[™], 341[®], 342[®] and 344[®]: 600 volts maximum building wire; 1000 volts signs or lighting fixtures.

Model 347: 1000V maximum

IDEAL INDUSTRIES, INC.

Sycamore, IL 60178 U.S.A. 800-435-0705 Customer Assistance www.idealind.com IS 0031-1